



# XTC

## DIRECTIONS & APPLICATION INFORMATION



XTC is a high temperature/heat resistant coating formulated specifically to protect metal surfaces operating at temperatures from 500°F (260°C) to 1500°F (812°C). With proper preparation, XTC (Xtreme Temperature Coating) provides outstanding adhesion, film integrity, corrosion, weathering and thermal shock-resistance throughout this entire temperature range, and is guaranteed not to burn off!

To achieve expert results, please take the time to carefully read and understand the following directions before you begin your restoration project. These directions are meant to be general guidelines only and do not cover every application or environmental situation. If you have remaining questions or concerns, please call us toll-free for technical assistance.

**ALWAYS WEAR PROTECTIVE GLOVES AND SAFETY GLASSES. ALWAYS WORK IN A WELL-VENTILATED AREA. Please heed all warning and caution notices on all KBS products.**

### RECOMMENDED USES:

Engines, Manifolds, Headers, Mufflers • Furnaces, Kilns, Ovens, Stoves • Compressors, Turbines • Stoves (wood, coal, pellet, gas, etc.) • Fireplace hoods, screens, & accessories

### FEATURES:

Withstands continuous temperature of up to 1500°F (812°C) • Outstanding heat and weathering resistance • Will not peel, flake, or chalk • Long Lasting • Dries for handling in 15 mins • Once heat cured, is resistant to scratching & marring

### NOT RECOMMENDED FOR:

Parts that will be immersed • Direct contact with open flame • Cooking surfaces

### SURFACE PREPARATION:

Surface to be primed and painted must be dry and free from dirt, oils, rust, and other contaminants. Sandblasting is the ideal surface preparation as it leaves the ideal anchor pattern for paint adhesion. After sandblasting, use clean compressed air to blow off any residual blast media. Be sure to wear surgical-type gloves when handling to keep natural body oils off the prepared surface.

If not sandblasting, prepare surface by using wire wheel, wire brushing, or abrasive sanding using 60-80 grit paper. This method will provide a surface equivalent to that provided by sandblasting and allow the desired surface profile or anchor pattern. Wash surface well with KBS Klean at a 10:1 (10 Parts Hot Water and 1 Part KBS Klean) ratio, rinse and let dry thoroughly. Allow surface to **thoroughly dry** before proceeding. Mask off areas not to be coated & protect adjacent areas with drop cloth or newspapers. For best results, apply when XTC and room temperatures are between 60-80° F (16-27° C).

### MIXING:

Do not open containers until ready to use. Re-disperse any settled-out pigments by stirring with a paint paddle or power mixer to a uniform consistency. Effective stirring includes repeatedly touching bottom of can & lifting to disperse any settled pigments and/or matting agents. Placing paint can upside down for a short time before opening & stirring will aid with proper mixing. Keep lid on container when not in use.

### COVERAGE:

Theoretical coverage at one mil (25 microns) is 400 (Alum)/300 (All Others) sq.ft. per gallon OR 9.6 (Alum)/7.0 (All Others) sq.m. per liter. Recommended thickness of two mils (50 microns) would require two full coats. Material losses during mixing and application will vary and must be taken into consideration. Expect up to 30% less coverage on rough surfaces. Aerosol can theoretically covers 8 sq. ft.

### APPLICATION:

Ideal application temperatures of air & surface to be coated are 50-82°F (15-28°C). XTC may be applied by conventional or HVLP spray, airless spray, brush or roller. Do not apply XTC in heavy thickness because blistering may occur. For corrosion protection, metal surfaces should be primed with XTC Silicone Zinc Primer (approx. 1.0 mils/25um DFT), then topcoated with one coat (1.0 mils/25um DFT) of the XTC color of your choice. **ALWAYS APPLY THIN, COVERING COATS!**

If not using XTC Zinc Primer, apply two coats (1.0 mils/25um DFT each) of XTC allowing at least 8 hours between coats and allow the second coat to dry at least 8 hrs before subjecting surface to any heat. The number of coats of XTC needed depends upon service conditions of equipment.

### SPRAY APPLICATION:

FOLLOW ALL CAUTION & WARNING NOTICES WHEN SPRAYING. ALWAYS WEAR AN AIR SUPPLIED RESPIRATOR: NIOSH/MSHA approved organic vapor particulate respirator. Spray pressure of 35-45 psi (250-330kpa) for siphon/pot guns and 25-35psi (170-250kpa) for gravity/top container guns. Thinning is not generally required but if needed 5%-10% is normally adequate. Use KBS #1 Thinner only which is a slow evaporating solvent. Do not reduce XTC with lacquer thinner. Also remember to clean your spray gun immediately after using XTC. As a general rule of thumb, we recommend a 1.4-1.5 nozzle. **ALWAYS APPLY THIN, COVERING COATS!**

### BRUSH APPLICATION:

FOR BEST RESULTS, use natural bristle or foam/sponge brushes. Apply thin covering coats (1.5-2.0 mils/35-50um wet film thickness). Do not flood surface with coating. As with all KBS Products, multiple thin coats is always the best practice. Brush out thoroughly, maintaining a continuous wet edge and uniform appearing paint film. Do not over work brushing while attempting to eliminate brush marks. Whatever brush marks don't flow out during air dry process will flow out during initial heat curing. Do however avoid runs or drips. Allow first coat to air dry at least 8 hrs before applying recommended second coat. Allow second coat to cure at least 8 hrs before subjecting to temperature curing. **ALWAYS APPLY THIN, COVERING COATS!**

### AEROSOL SPRAY APPLICATION:

For best results, apply when spray can and room temperatures are between 60-80° F (16-27° C). Shake can vigorously for one minute after mixing ball rattles freely & periodically during use to ensure proper mixing and to prevent spray head from clogging. Repeat shaking frequently during use. Hold can 12-15 inches from surface and apply using steady, even strokes. Apply a minimum of two light coats, avoiding drips & runs. Allow 15-30 minutes drying time between coats. Heavy applications can lead to reduced coating life/adhesion. Clean spray head immediately after use by turning can upside down and spraying until no more paint appears. If clogging occurs, remove spray head and clean with a fine wire. Replace carefully, pointing can and spray head away from you. Allow painted surface to dry a minimum of 8 hrs before subjecting to high heat.

### TEMPERATURE CURING:

After proper dry time, coating will be dry to the touch and can be handled using care, but resins will not reach full hardness until heated to approx. 350° F (176° C). For headers or manifolds, this can be done in an oven, BBQ, or by mounting back on engine and run to normal operating temperature. NOTE: Coating can emit potentially harmful vapors during the first few heat/cool cycles. Allow for full and proper ventilation during initial heat curing. Avoid excessive heat during this initial "break-in" period, as the resins need to be tempered into the substrate to provide proper adhesion.

**ALWAYS APPLY THIN, COVERING COATS!**

### THINNING:

XTC can be thinned up to 5% (20 parts paint/1 part thinner). Only thin using KBS #1 Thinner. Note: Use of other thinners not approved by KBS may hinder product performance and void product guarantee.

## DRY TIME:

70°F (21°C) 50% RH. XTC will air dry tack and thumb print free within 1/2-1 hour. Allow at least 8 hours dry time between coats. Allow at least 8 hour solvent flash off period before heat curing or placing into service. **Optimum film properties require a heat cure of 350°F (176°C) for 20 minutes.** Equipment such as exhaust manifolds & headers protected with the XTC in the air-dried state will heat cure when placed into service.

## CLEAN UP:

Thoroughly flush spray equipment and hoses immediately after use with KBS #1 Thinner or lacquer thinner. Dismantle spray equipment and clean parts, brushes or rollers.

## STORAGE:

Store in a cool, dry place with temperatures between 50°F and 100°F (10°C and 38°C). Keep container closed when not in use.

## QUESTIONS & TIPS:

**Q.** Do I need to sandblast?

**A.** No, while a sandblasted surface is ideal for cleaning & providing an ideal anchor pattern or coating adhesion, wire brushing and/or abrasive sanding with 60-80 grit sandpaper will work well also.

**Q.** How many coats of XTC do I really need?

**A.** We recommend a minimum of two coats of XTC or one coat of XTC Primer & one coat of XTC (color of your choice). Additional coats of XTC will just add to the durability and add corrosion protection.

**Q.** Do I need to heat the surface before painting?

**A.** No, the surface should be at room temperature 50-82°F (15-28°C) during application. Do not apply to a hot surface.

**Q.** Do I need to heat cure after application?

**A.** Yes, while the surface will dry to the touch within 1/2-1 hour, the coating will not reach its full cure until it reaches approximately 350°F (176°C).

**Q.** Do I need to heat cure between coats?

**A.** No, heat curing between coats is not necessary, but heat curing will not hinder subsequent coats of XTC.

## TECHNICAL DATA:

Characteristics	Jet Black, Cast Iron Grey, Charcoal Metallic, Flame Blue, Pure White, Off-White, Rocket Red, Clear	Aluminum Stainless Steel, Pontiac Metallic Blue
Generic Type	Silicone	Silicone
Color	Black, Grey, Red, White, Blue, Ivory, Clear	Silver
Temperature resistance Continuous Intermittent	1500°F (815°C) 1600°F (871°C)	1500°F (815°C) 1600°F (871°C)
Percent (%) Solids by Volume	18 (varies with color)	25
Viscosity	300-450 cps (varies with color)	300-450 cps
Dry film thickness per coat	0.75-1.0 mils (19-25 µm)	1.5-2.0 mils (19-25 µm)
Wet film thickness per coat	4-5 mils (100-125 µm)	6-8 mils (150-200 µm)
Theoretical coverage	289 mil. sq.ft. (27 sq.m. @ 25µm)	401 mil. sq.ft.

Characteristics	Jet Black, Cast Iron Grey, Charcoal Metallic, Flame Blue, Pure White, Off-White, Rocket Red, Clear	Aluminum Stainless Steel, Pontiac Metallic Blue
Drying time @ 50% RH To Touch To Handle To Recoat To Ship	50°F (10°C) 70°F (21°C) 50 min 25 min 1 hour 30 min 10 hours 7 hours 42 hours 20 hours	50°F (10°C) 70°F (21°C) 1 hour 30 min 1 hr 15 mins 40 min 12 hours 8 hours 48 hours 24 hours
Full cure @ 350°F (176°C)*	30 minutes	30 minutes
Weight per gallon	8.8 lb. (4.1 kg.)	9.6 lb. (4.3 kg.)
Flash Point	45°F (7°C)	45°F (7°C)
Pot life	N/A	N/A
Shelf life	1 year	1 year
Volatile organic compounds	5.85 lb./gal. (696 g./l.)	5.3 lb./gal. (630 g./l.)

\*See Dry Time Section

Please remember these instructions are general guidelines only and do not cover every application and environment. If you remain unsure as how to proceed, refer to product instruction sheet, our website:

**KBS-Coatings.com**, or call for technical advice at **1-219-263-0073**.

Please follow all warning and caution notices. See SDS for additional information.

## MADE IN THE USA.

Information contained herein is to our knowledge true and accurate, but all recommendations or suggestions are made without guarantee. Since application lies outside our control, we cannot accept any liability for the results. User shall determine the suitability of the product for its intended use, and user assumes all risk and liability whatsoever in connection therewith.

## KBS SUPPORT FORUM

SUCCESS.KBS-COATINGS.COM

## KBS FAQ's

SUPPORTDESK.KBS-COATINGS.COM

## COMPLETE HOW-TO's

KBS-COATINGS.COM

## KBS ONLINE INSTRUCTIONAL VIDEOS

VIEW 3-STEP SYSTEM APPLICATION VIDEOS  
AVAILABLE ON KBS-COATINGS.COM